

PRODUCT AFFECTED: JUND-60

TO SERVICE ENGINEERS: SUBJECT
MODIFICATION OF WIRING METHOD

This information is effective to such a failure that PATCH MODE sometimes changes into MANUAL MODE. This phenomenon happens caused by a bad contact of the connectors on both P.C.B.'s, POWER SUPPLY BOARD and PANEL BOARD-B.

You can apply this information to JUND-60 with the serial numbers 344800 and before, but you need not do it to JUND-60 with the serial numbers 344900 and up. Because the following modification has already been made to them.

MODIFICATION

Two wires for DC supply are added in parallel with present wires between the POWER SUPPLY BOARD and PANEL BOARD-B as shown in the attached drawing.

11/22

US (2), RCA (2), DK (4), Norway, Sweden, UK, WG, Canada, Swiss, France, Spain, Italy, Austria, BLX (2), Mexico, New Zealand, Finland, Greece, Svec Lee, Tom Lee.

Roland SERVICE INFORMATION

SERVICE DEPARTMENT

NO.	100202
DATE	July 29, 1983

PRODUCT AFFECTED: JUNO-60/6

TO SERVICE ENGINEERS:


SUBJECT

A Failure of IC 3R01

This information is our advice so that you may save a repair time for JUNO-60/6 related to IC 3R01 and may not have the same on a product from the same customer repeatedly, and this one should be applied to the both models with following serial numbers:

JUNO-60 : From S/No.317300 to 321299
JUNO-6 : From S/No.313700 to 324199

From our repair record in Japan market, it was found that some IC 3R01 in JUNO-60/6 became in failure and it was caused by a crack which happened on the molded package of the IC.

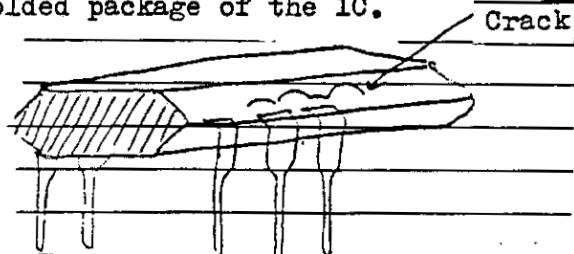

It seems that there is a possibility for IC 3R01 to be mixed in JUNO-60/6 with above serial numbers. We wish you to pay your attention to IC 3R01 when you have a chance to repair them. We advise you to replace the IC with a crack with new one which is sent under separate air service, even though the IC works normally, if you would find it.

NOTE : JUNO-60/6 show a phenomenon as shown below on each function if one of IC 3R01 are in failure:

VCA ENV. : Output volume does not change, or sometimes it change, or output sound leaks, or no output sound.

VCF ENV. : Sound does not change by ENV MOD., or sometimes it change.

DCO PWM. : Sound does not change by MOD ENV., or sometimes it change.

NOTE : 6 pcs of IC 3R01 have been used in a JUNO-6/60.

NOTE : We finished checking all JUNO-60/6 in our factory already and the checked JUNO-60/6 has **P** mark on the carton.

Handwritten signature